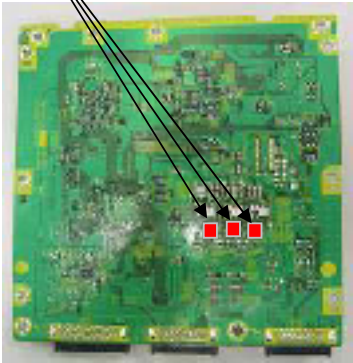


Subject	Color Faulty
Category	Plasma TV
Applicable Models	TH-37PW5 series, TH-37PWD5 series, TH-42PW5 series, TH-42PWD5 series TH-42PHD5 series, TH-42PHW5 series, TH-50PHD5 series, TH-50PHW5 series
Symptom	Panel may show the colour faulty in the part of TV screen. EX: Green Color Stop 
Cause	Faulty IC(Video Amp) in lot defect (Problem in IC production process) Ref No.: IC9002(G-Ch), IC9003(B-Ch), IC9004(R-Ch) Part No.:C0ABHA000033
Remedy	Replace IC9002, IC9003, IC9004 by new one. (Those ICs are located on D Board) 
Remark	Affected Production Serial.: Production from 2003/March(Y*321***) to 2003/June(Y*334***)